



W\_SE2/2007



**OTVC Crown CTV3721TX**  
**chassis PT92 Junior (strona 1/1)**

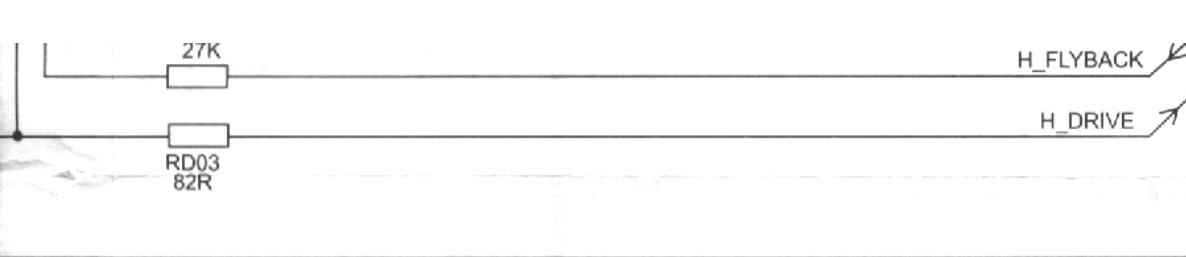






## VERTICAL

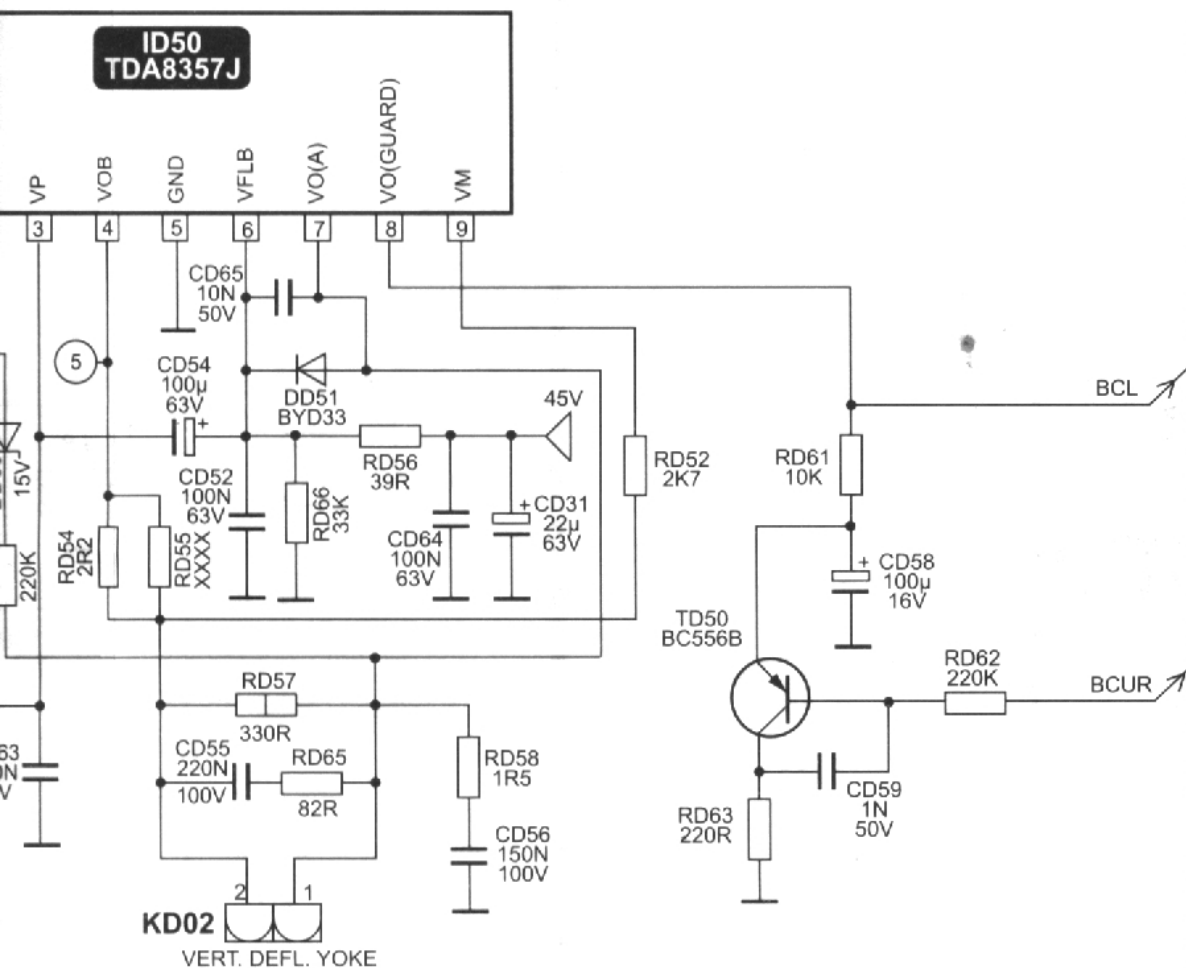


## SECAM L/L' MONO

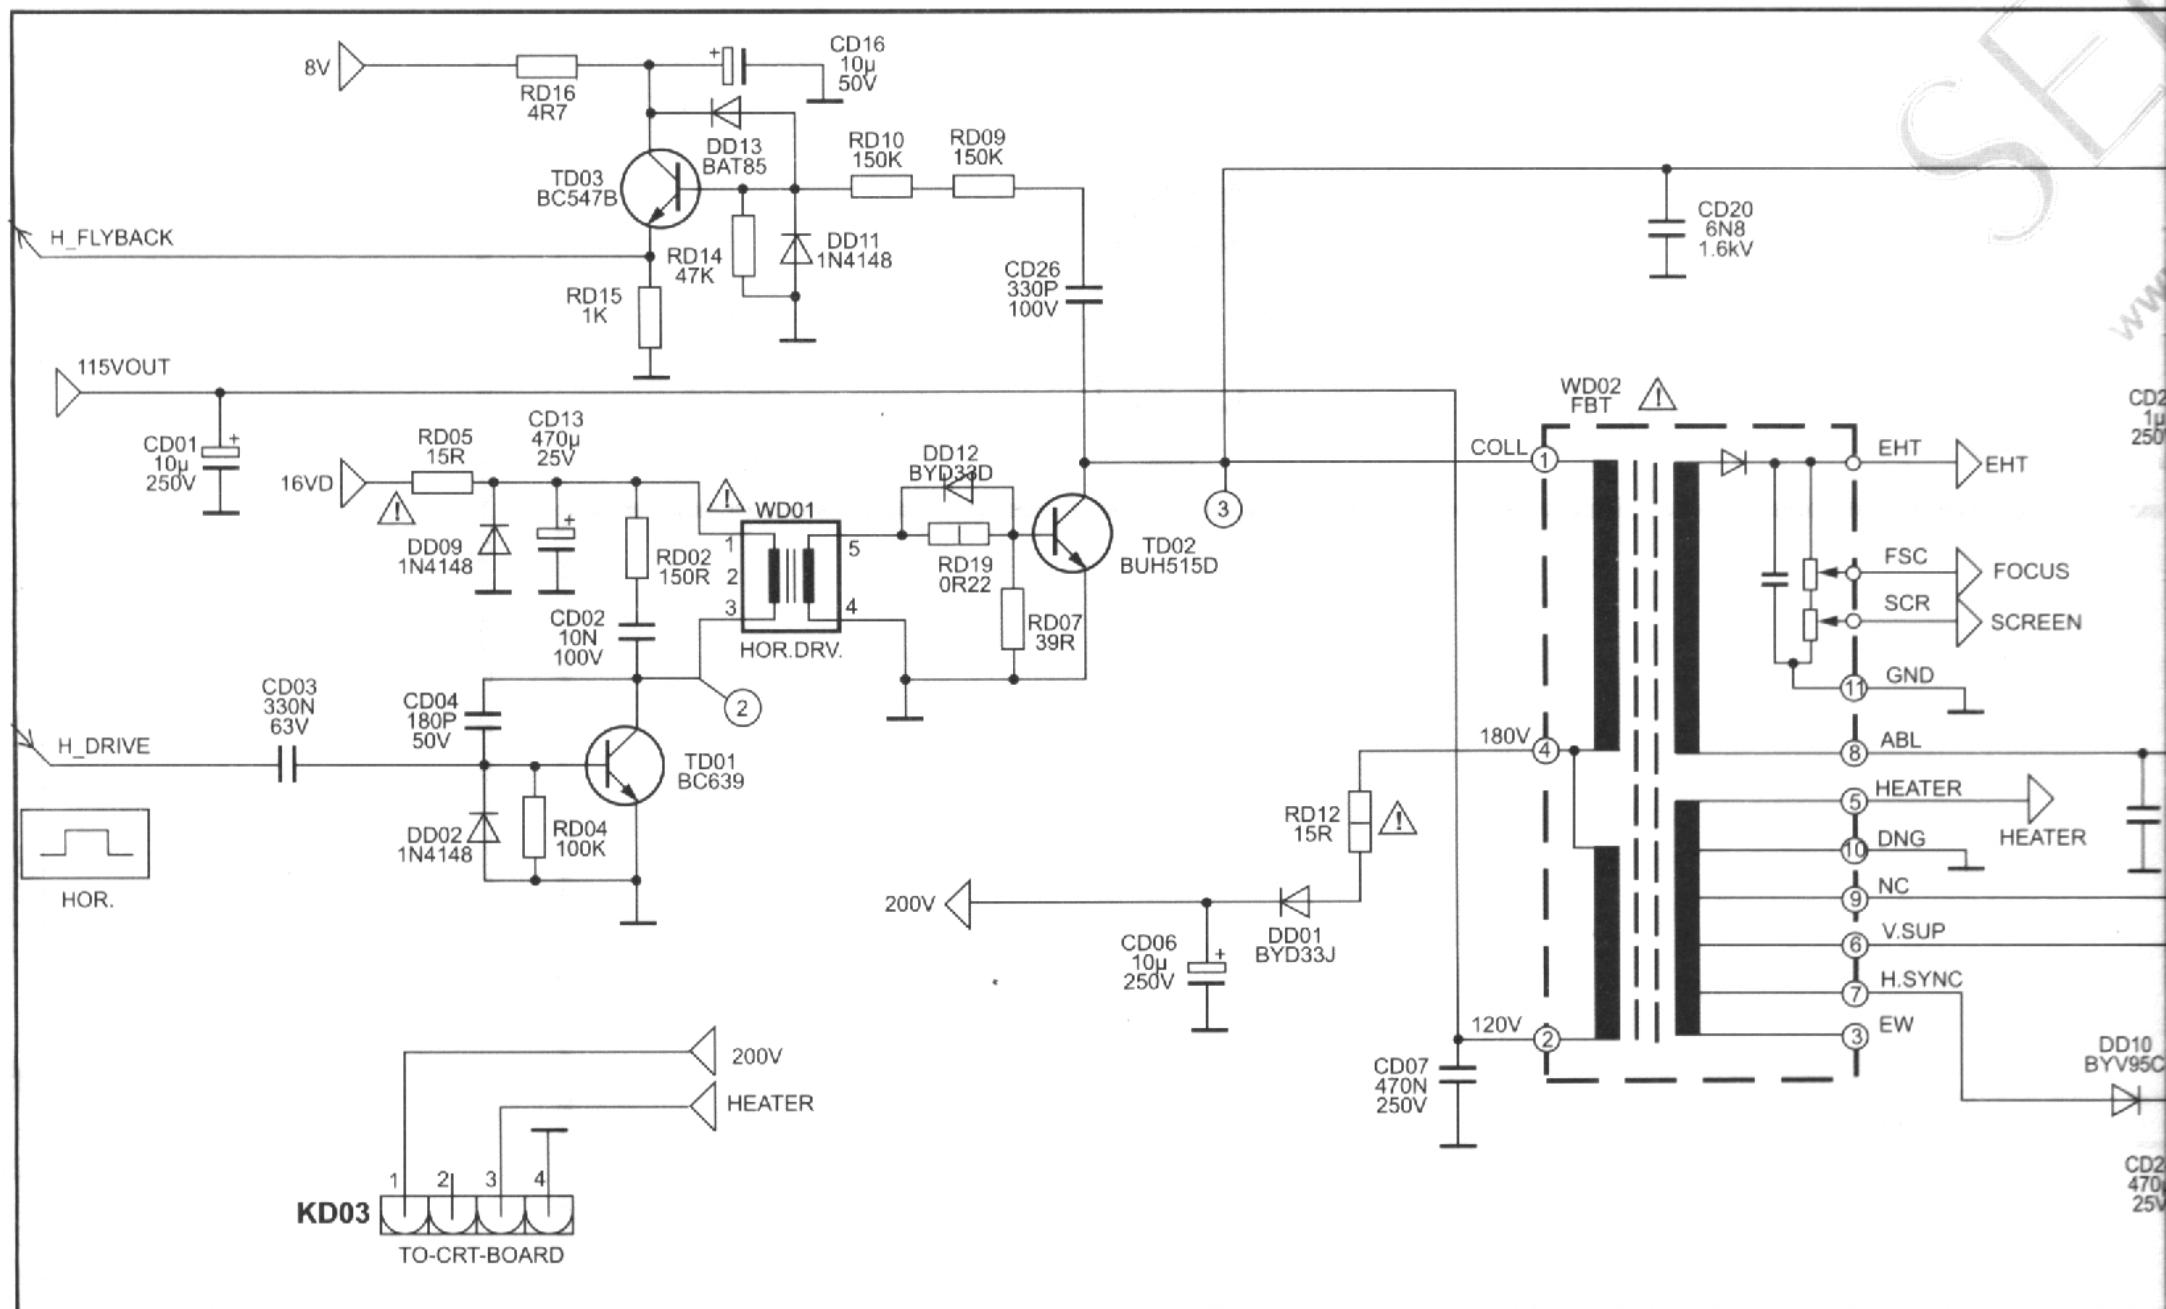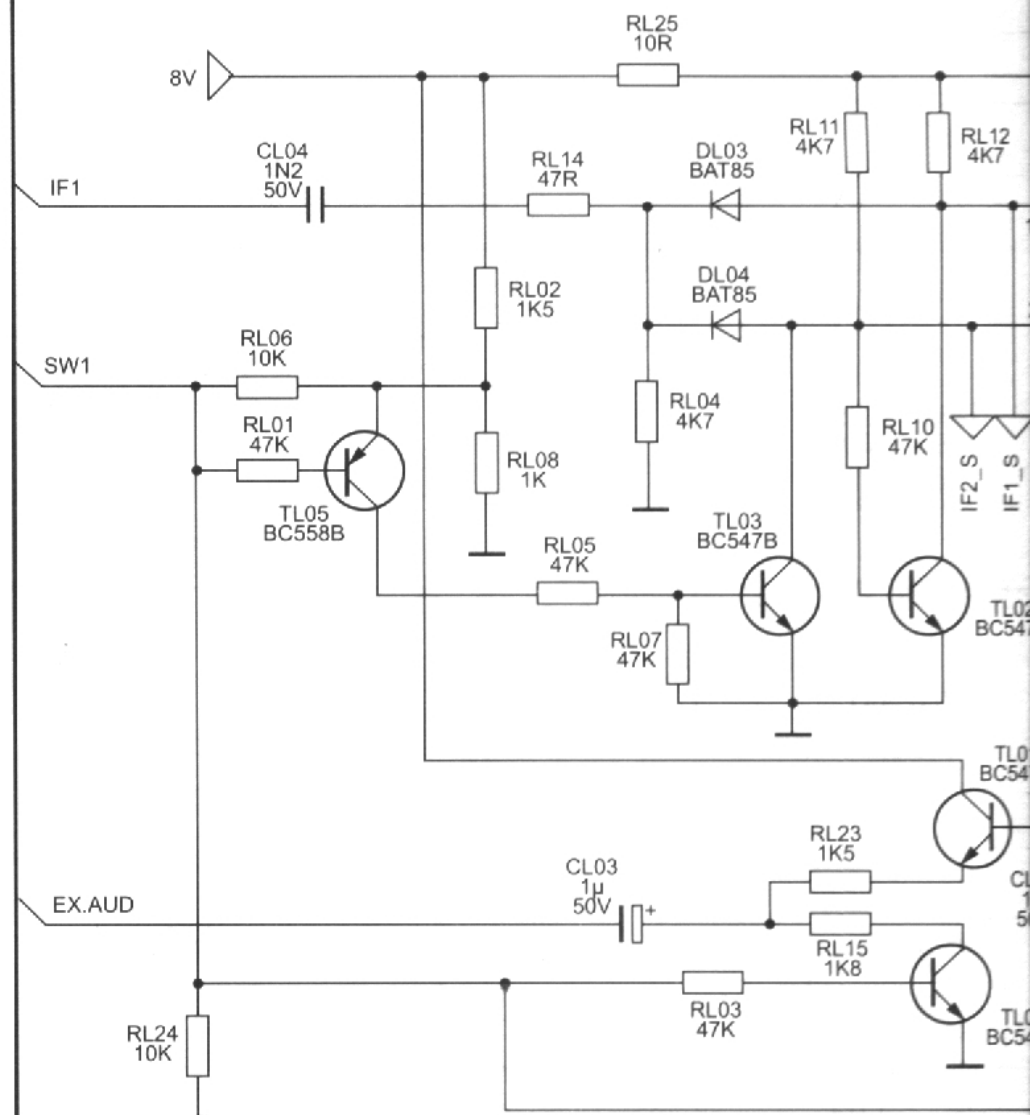




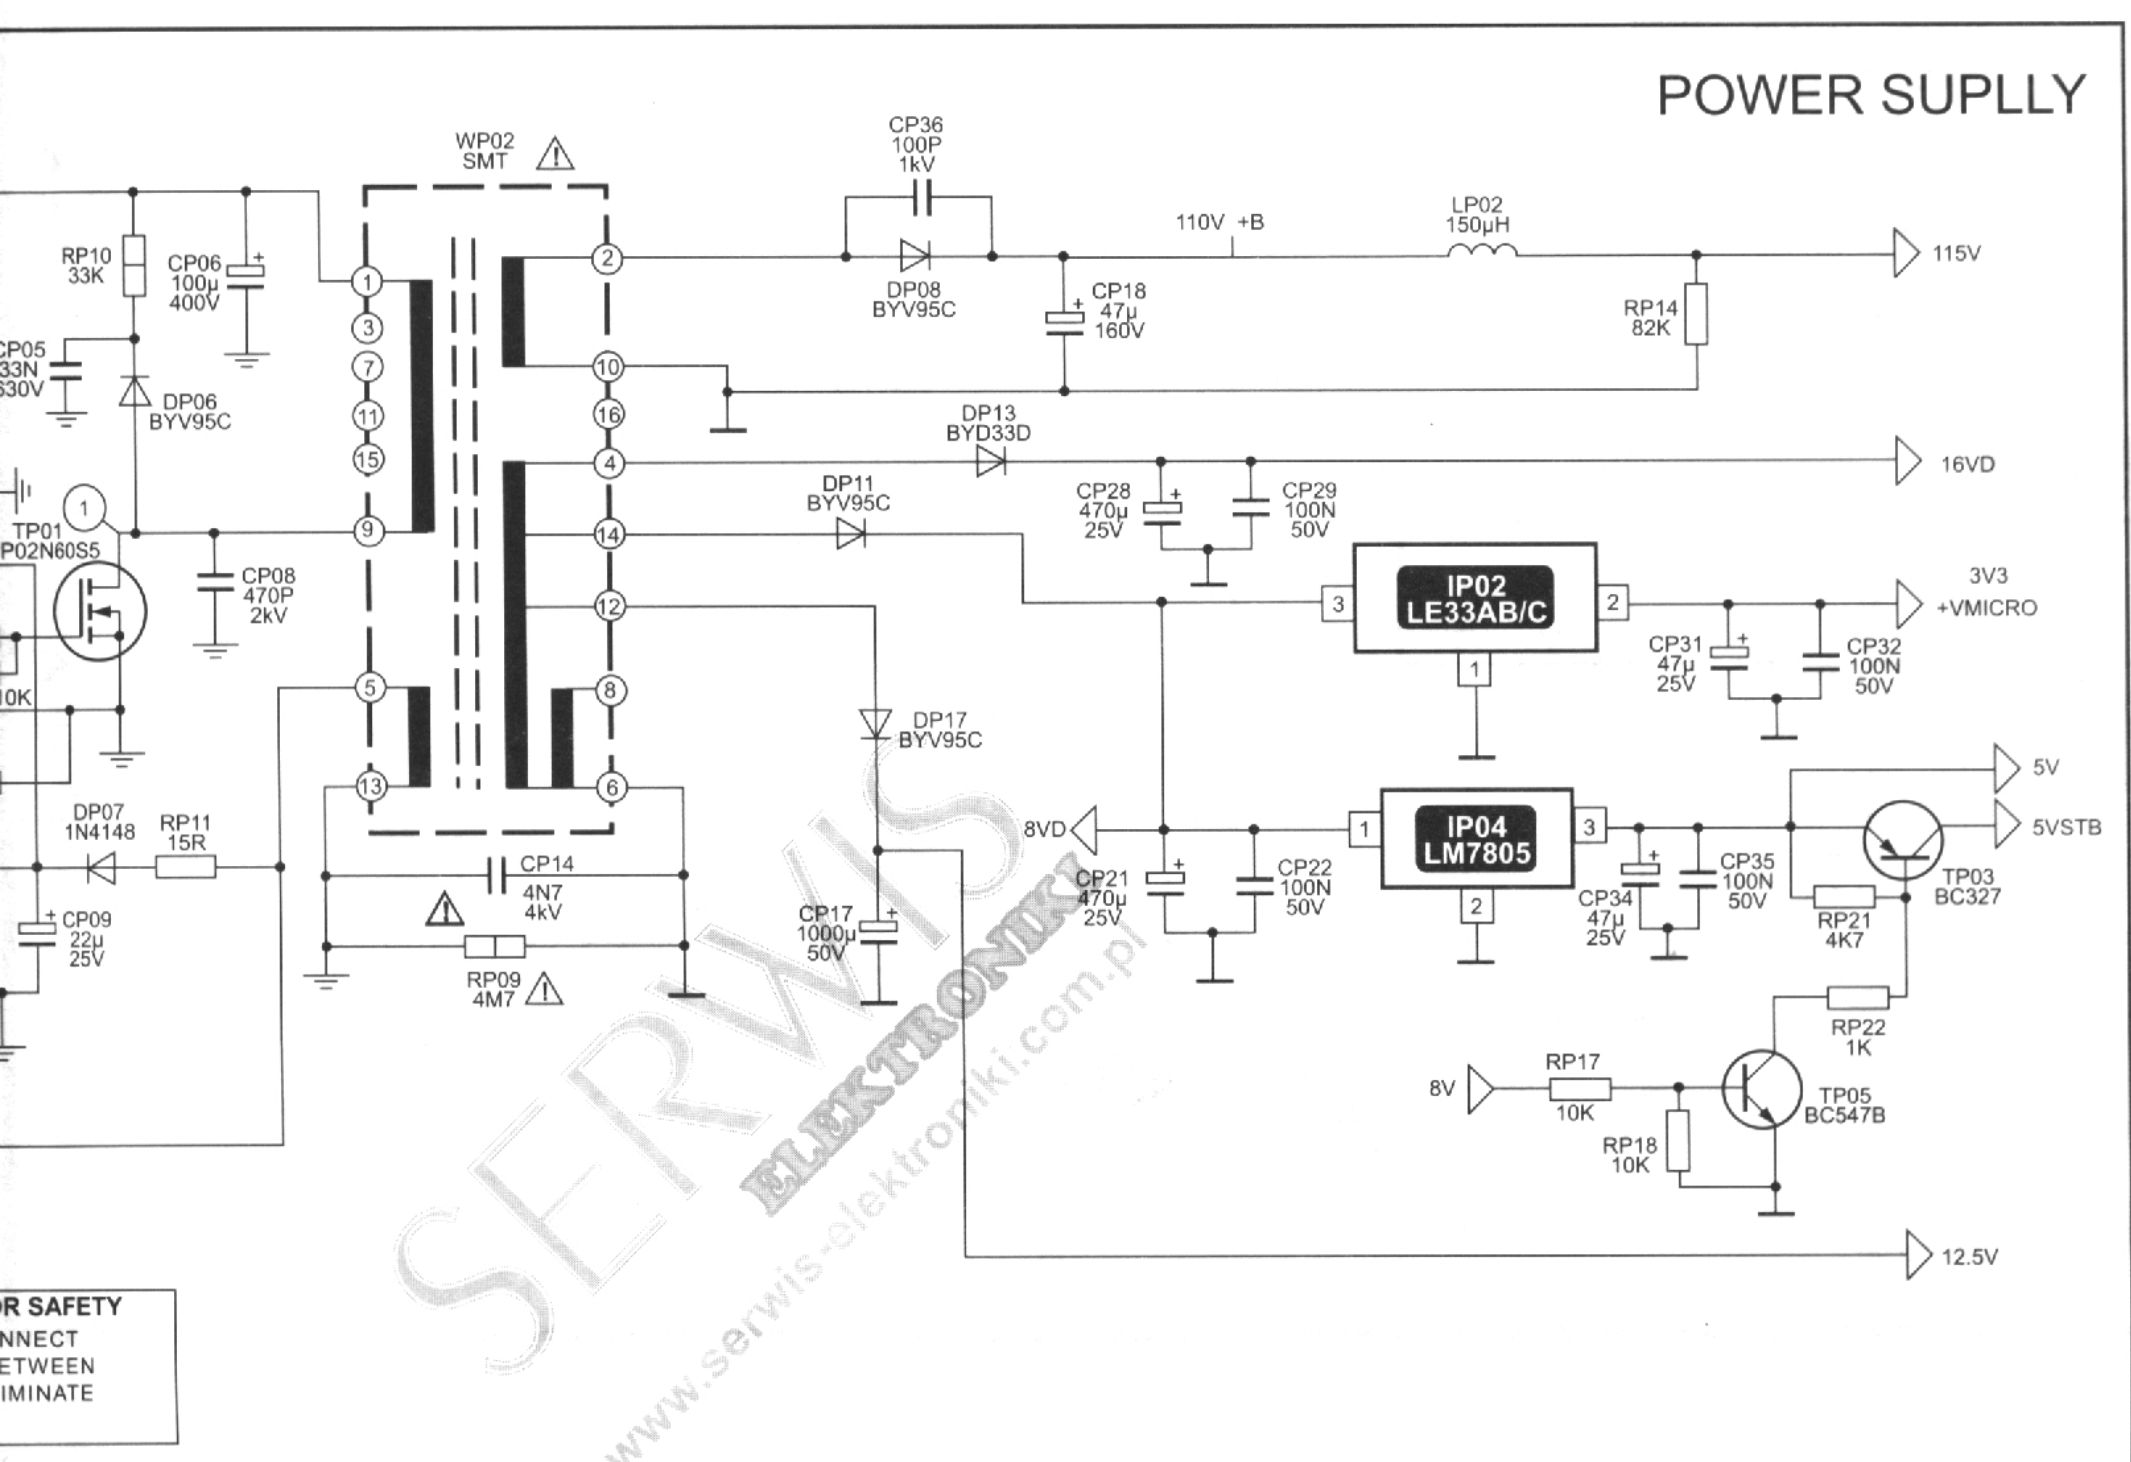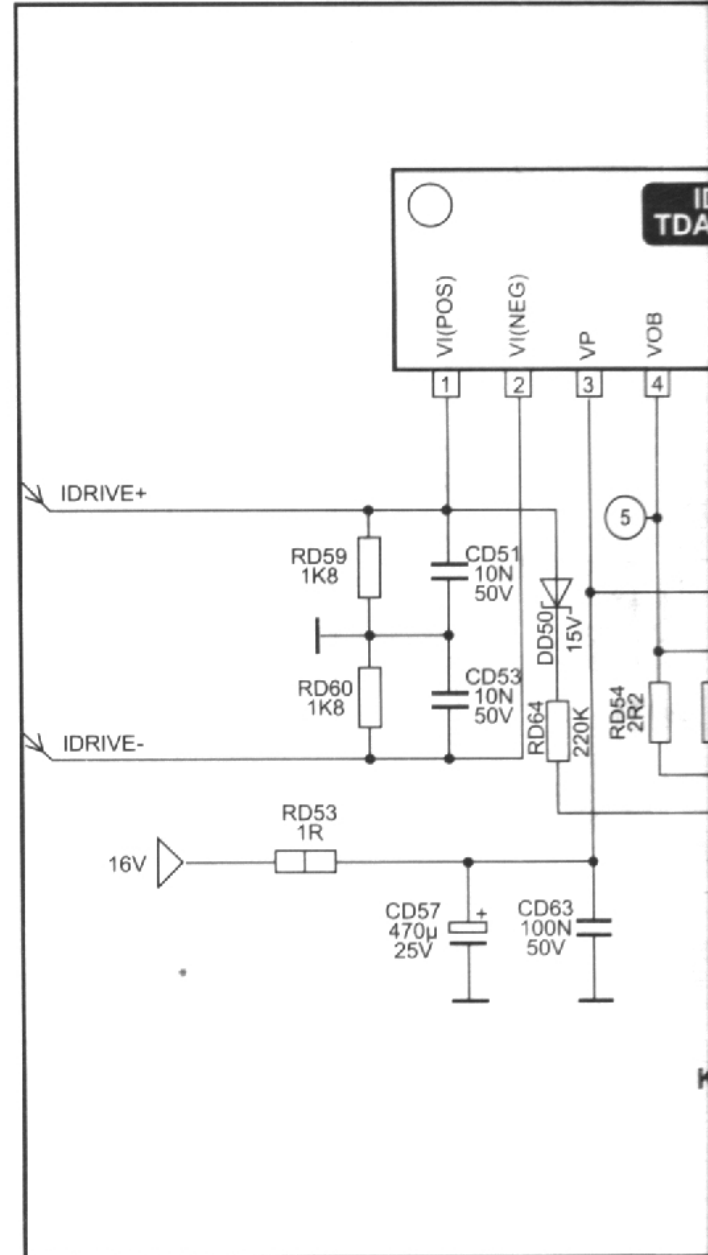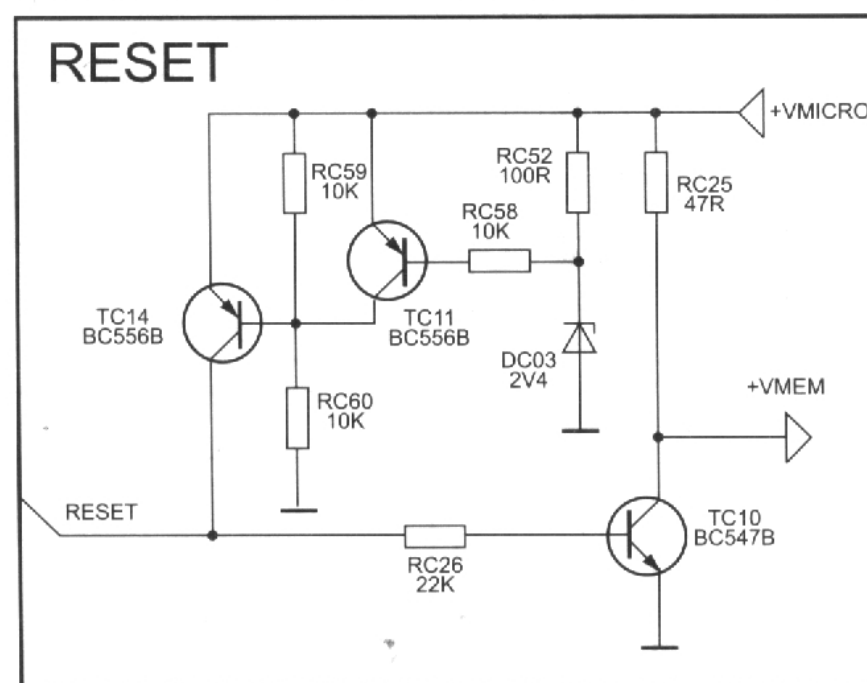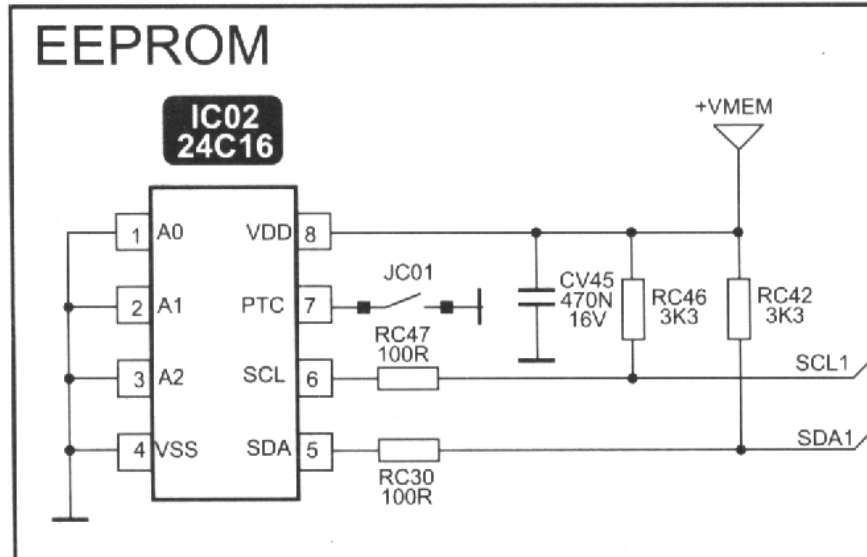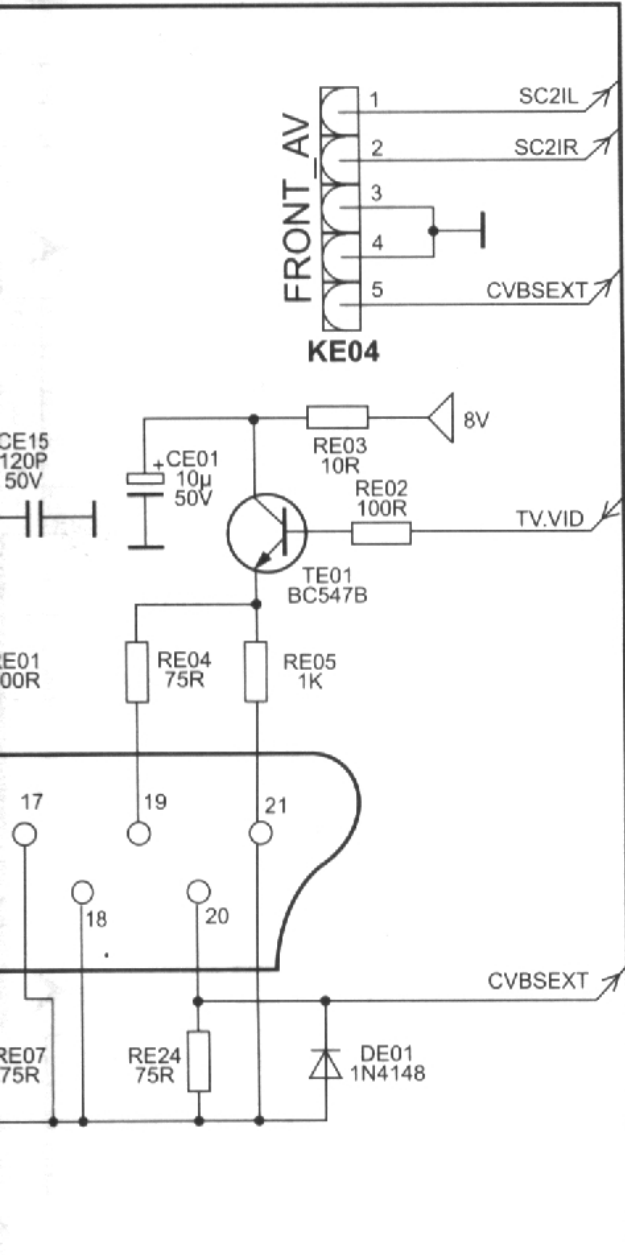

**SAFETY**  
CONNECT  
BETWEEN  
TERMINALS

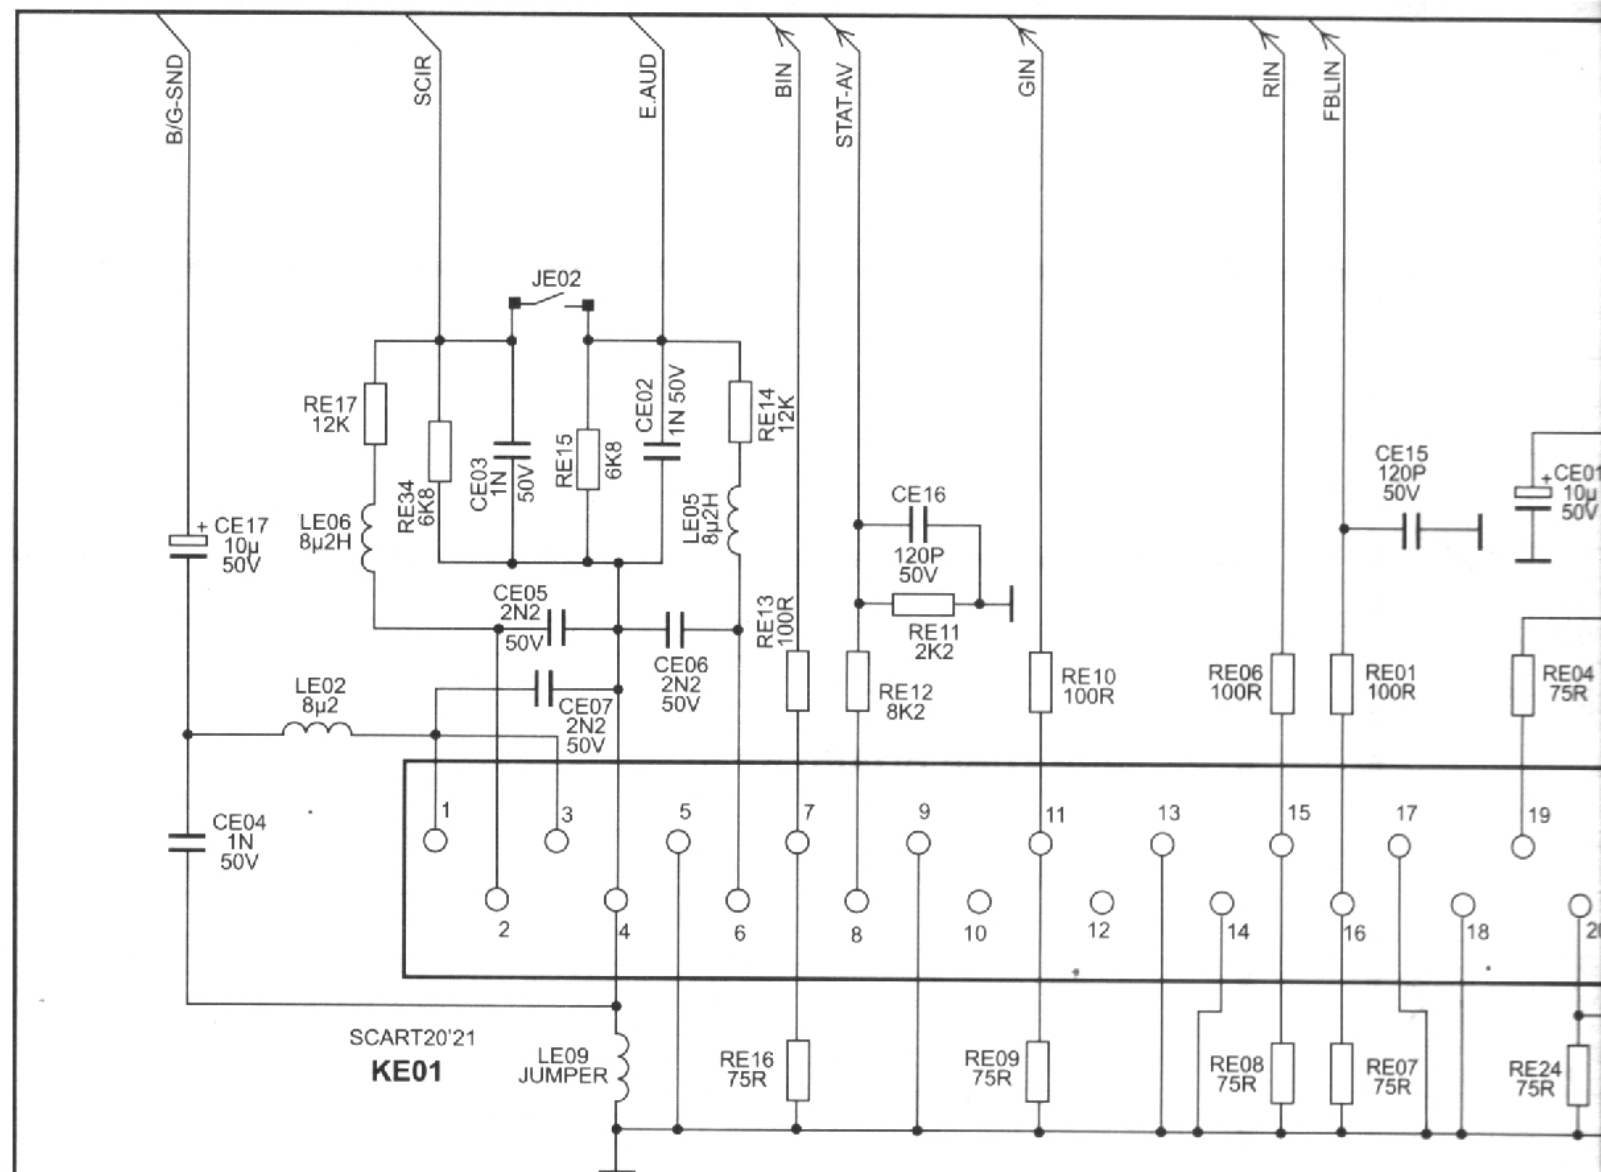



SCART


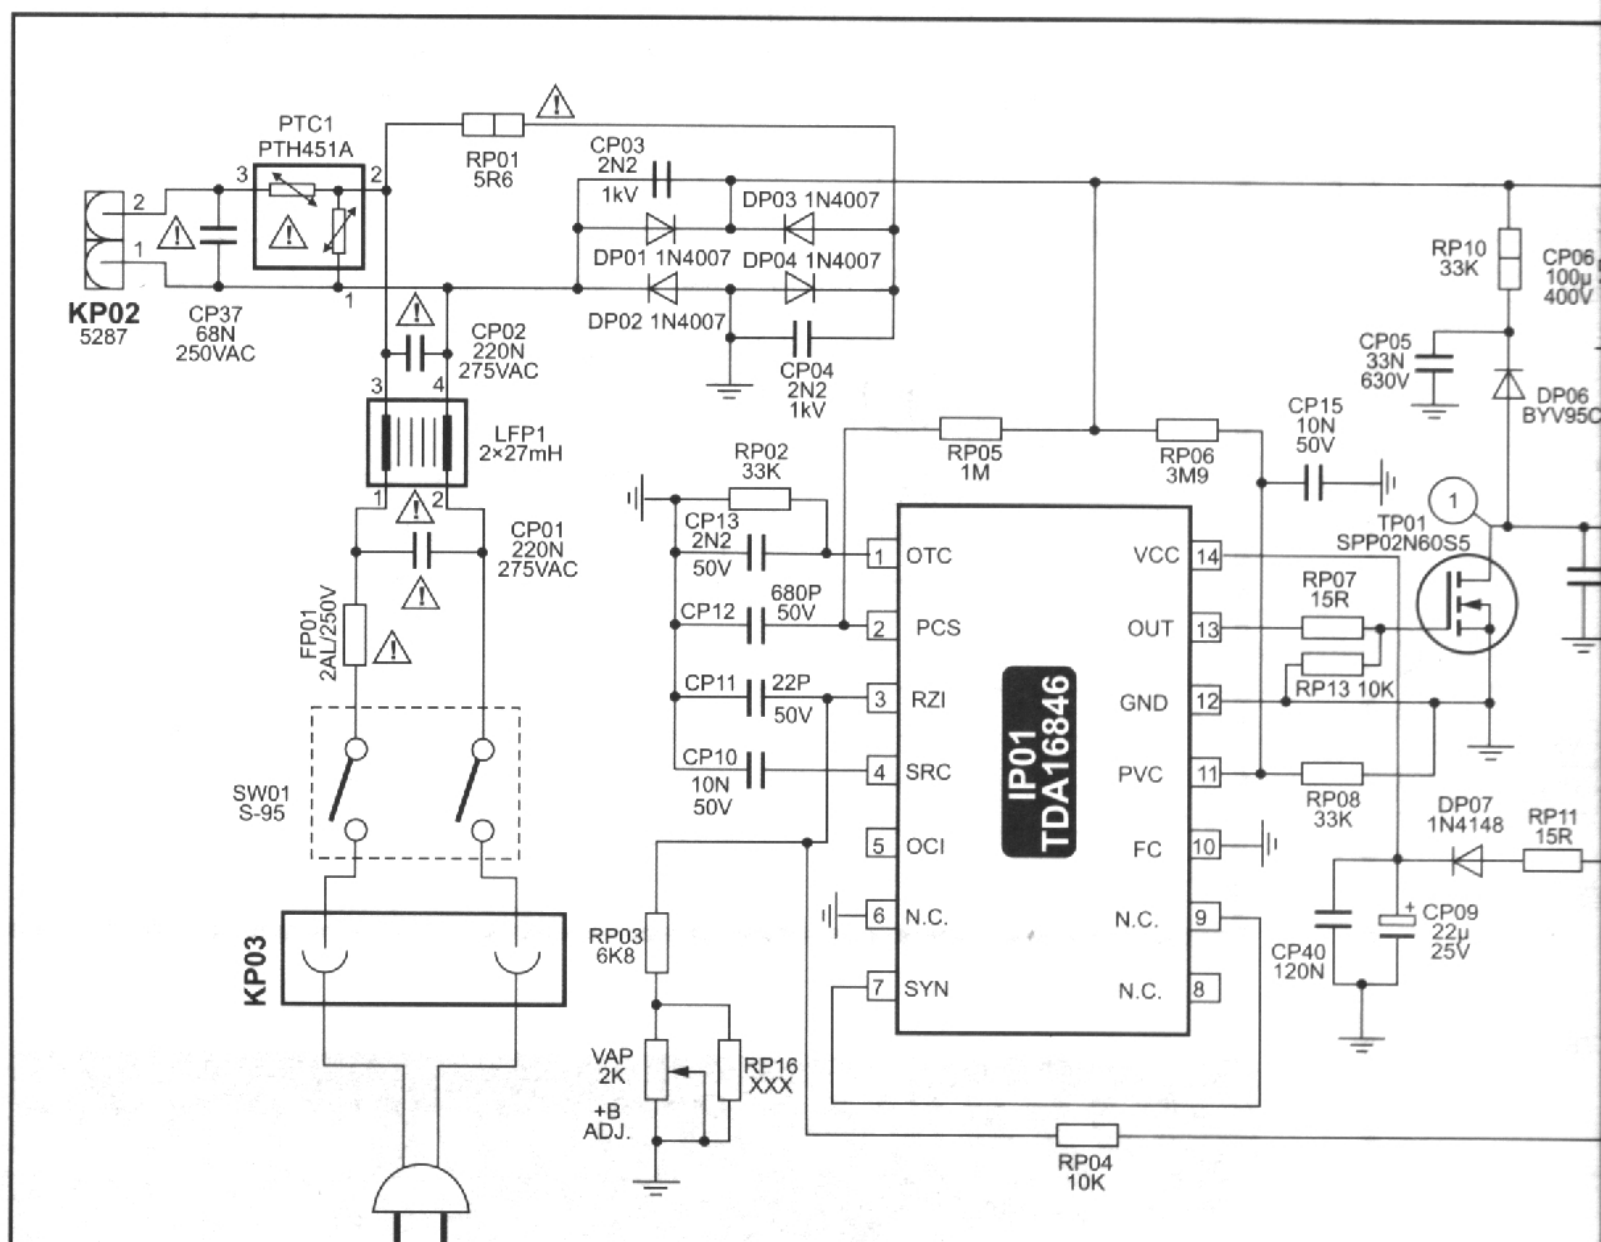


⚠ INDICATES SPECIALLY SELECTED OR CRITICAL SAFETY COMPONENTS AND IDENTICAL COMPONENTS SHOULD BE USED FOR THERE REPLACEMENT. THIS IS NECESSARY IN ORDER TO MAINTAIN THE OPERATIONAL SAFETY OF THE RECEIVER.

**THE SERVICE INFORMATION FOR SAFETY**  
WHEN SERVICING THIS AREA CONNECT AN ISOLATING TRANSFORMER BETWEEN TV RECEIVER AND AC LINE TO ELIMINATE HAZARD OF ELECTRIC SHOCK.




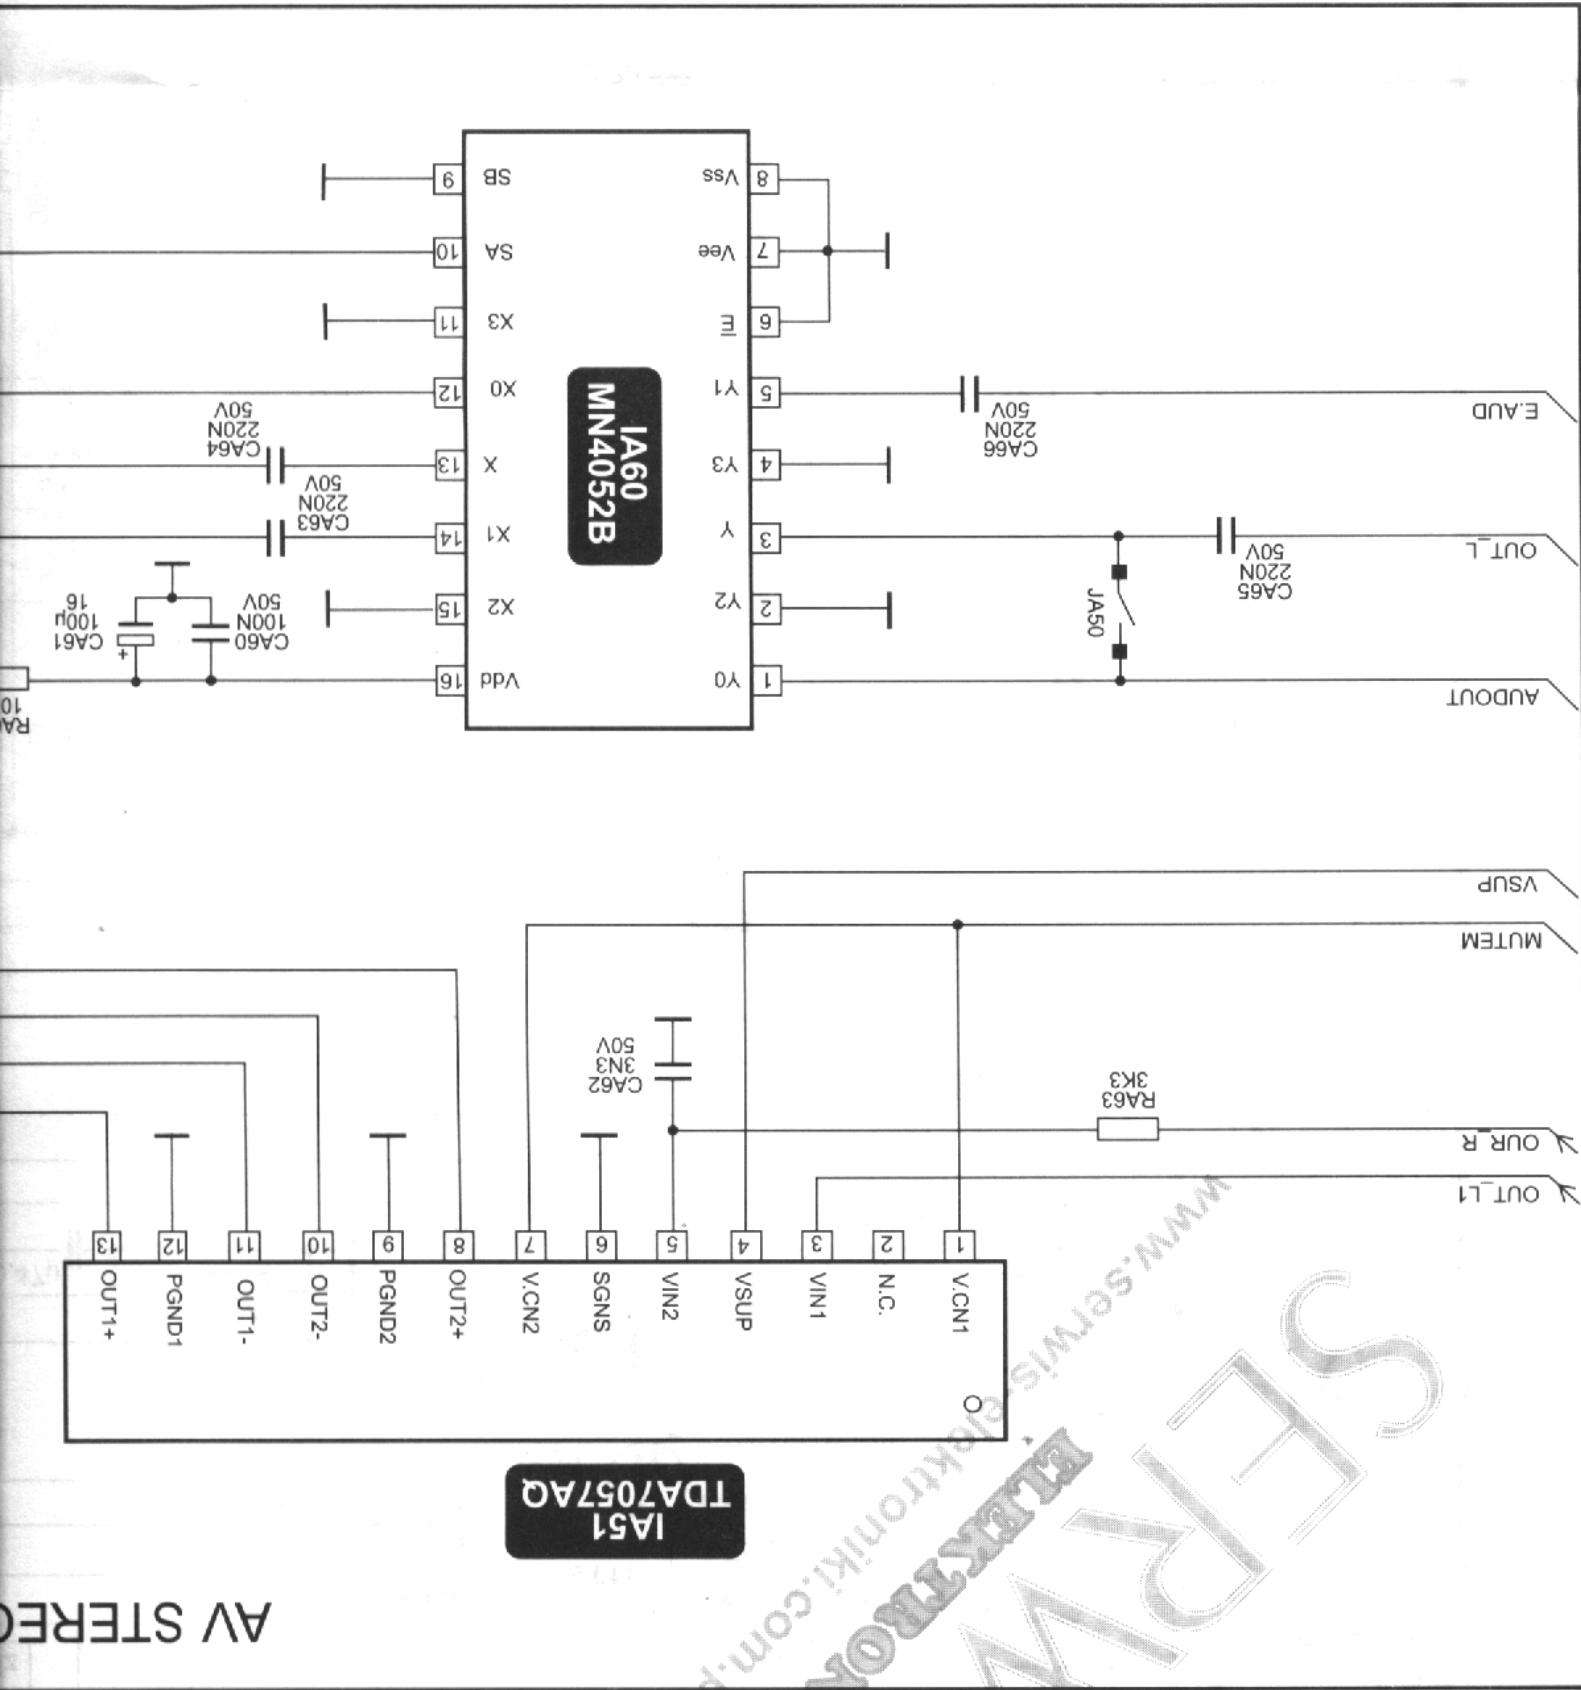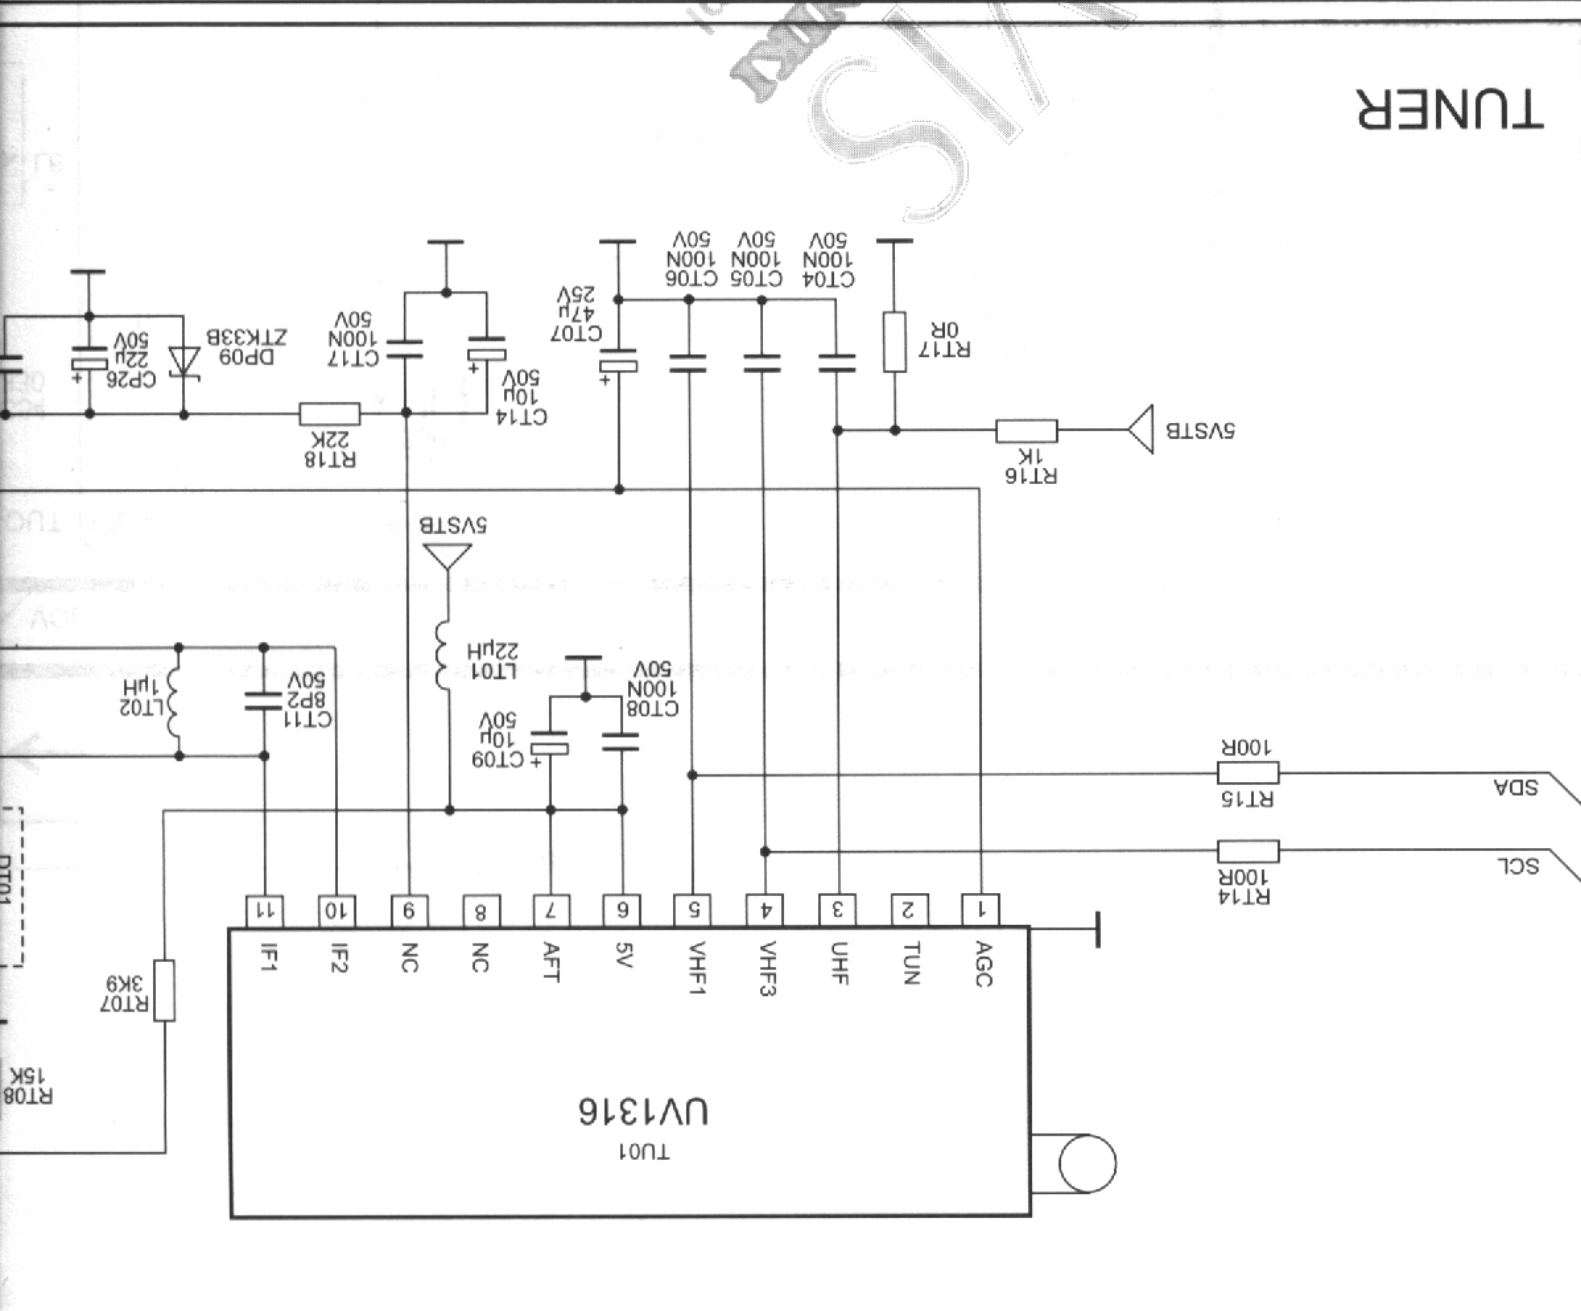

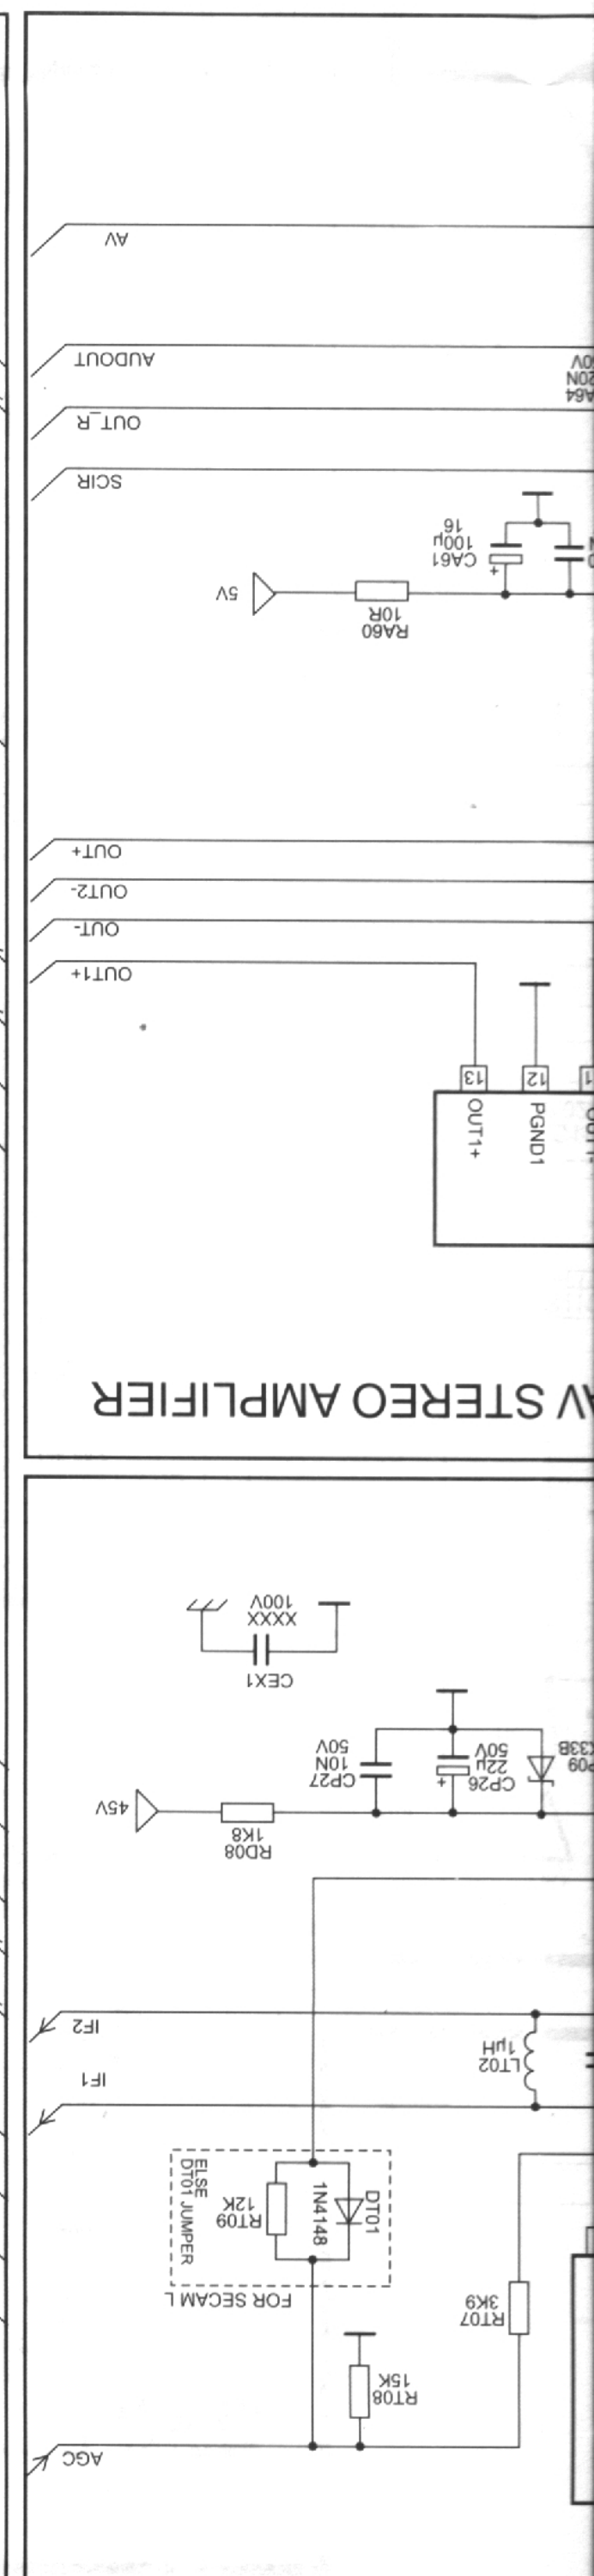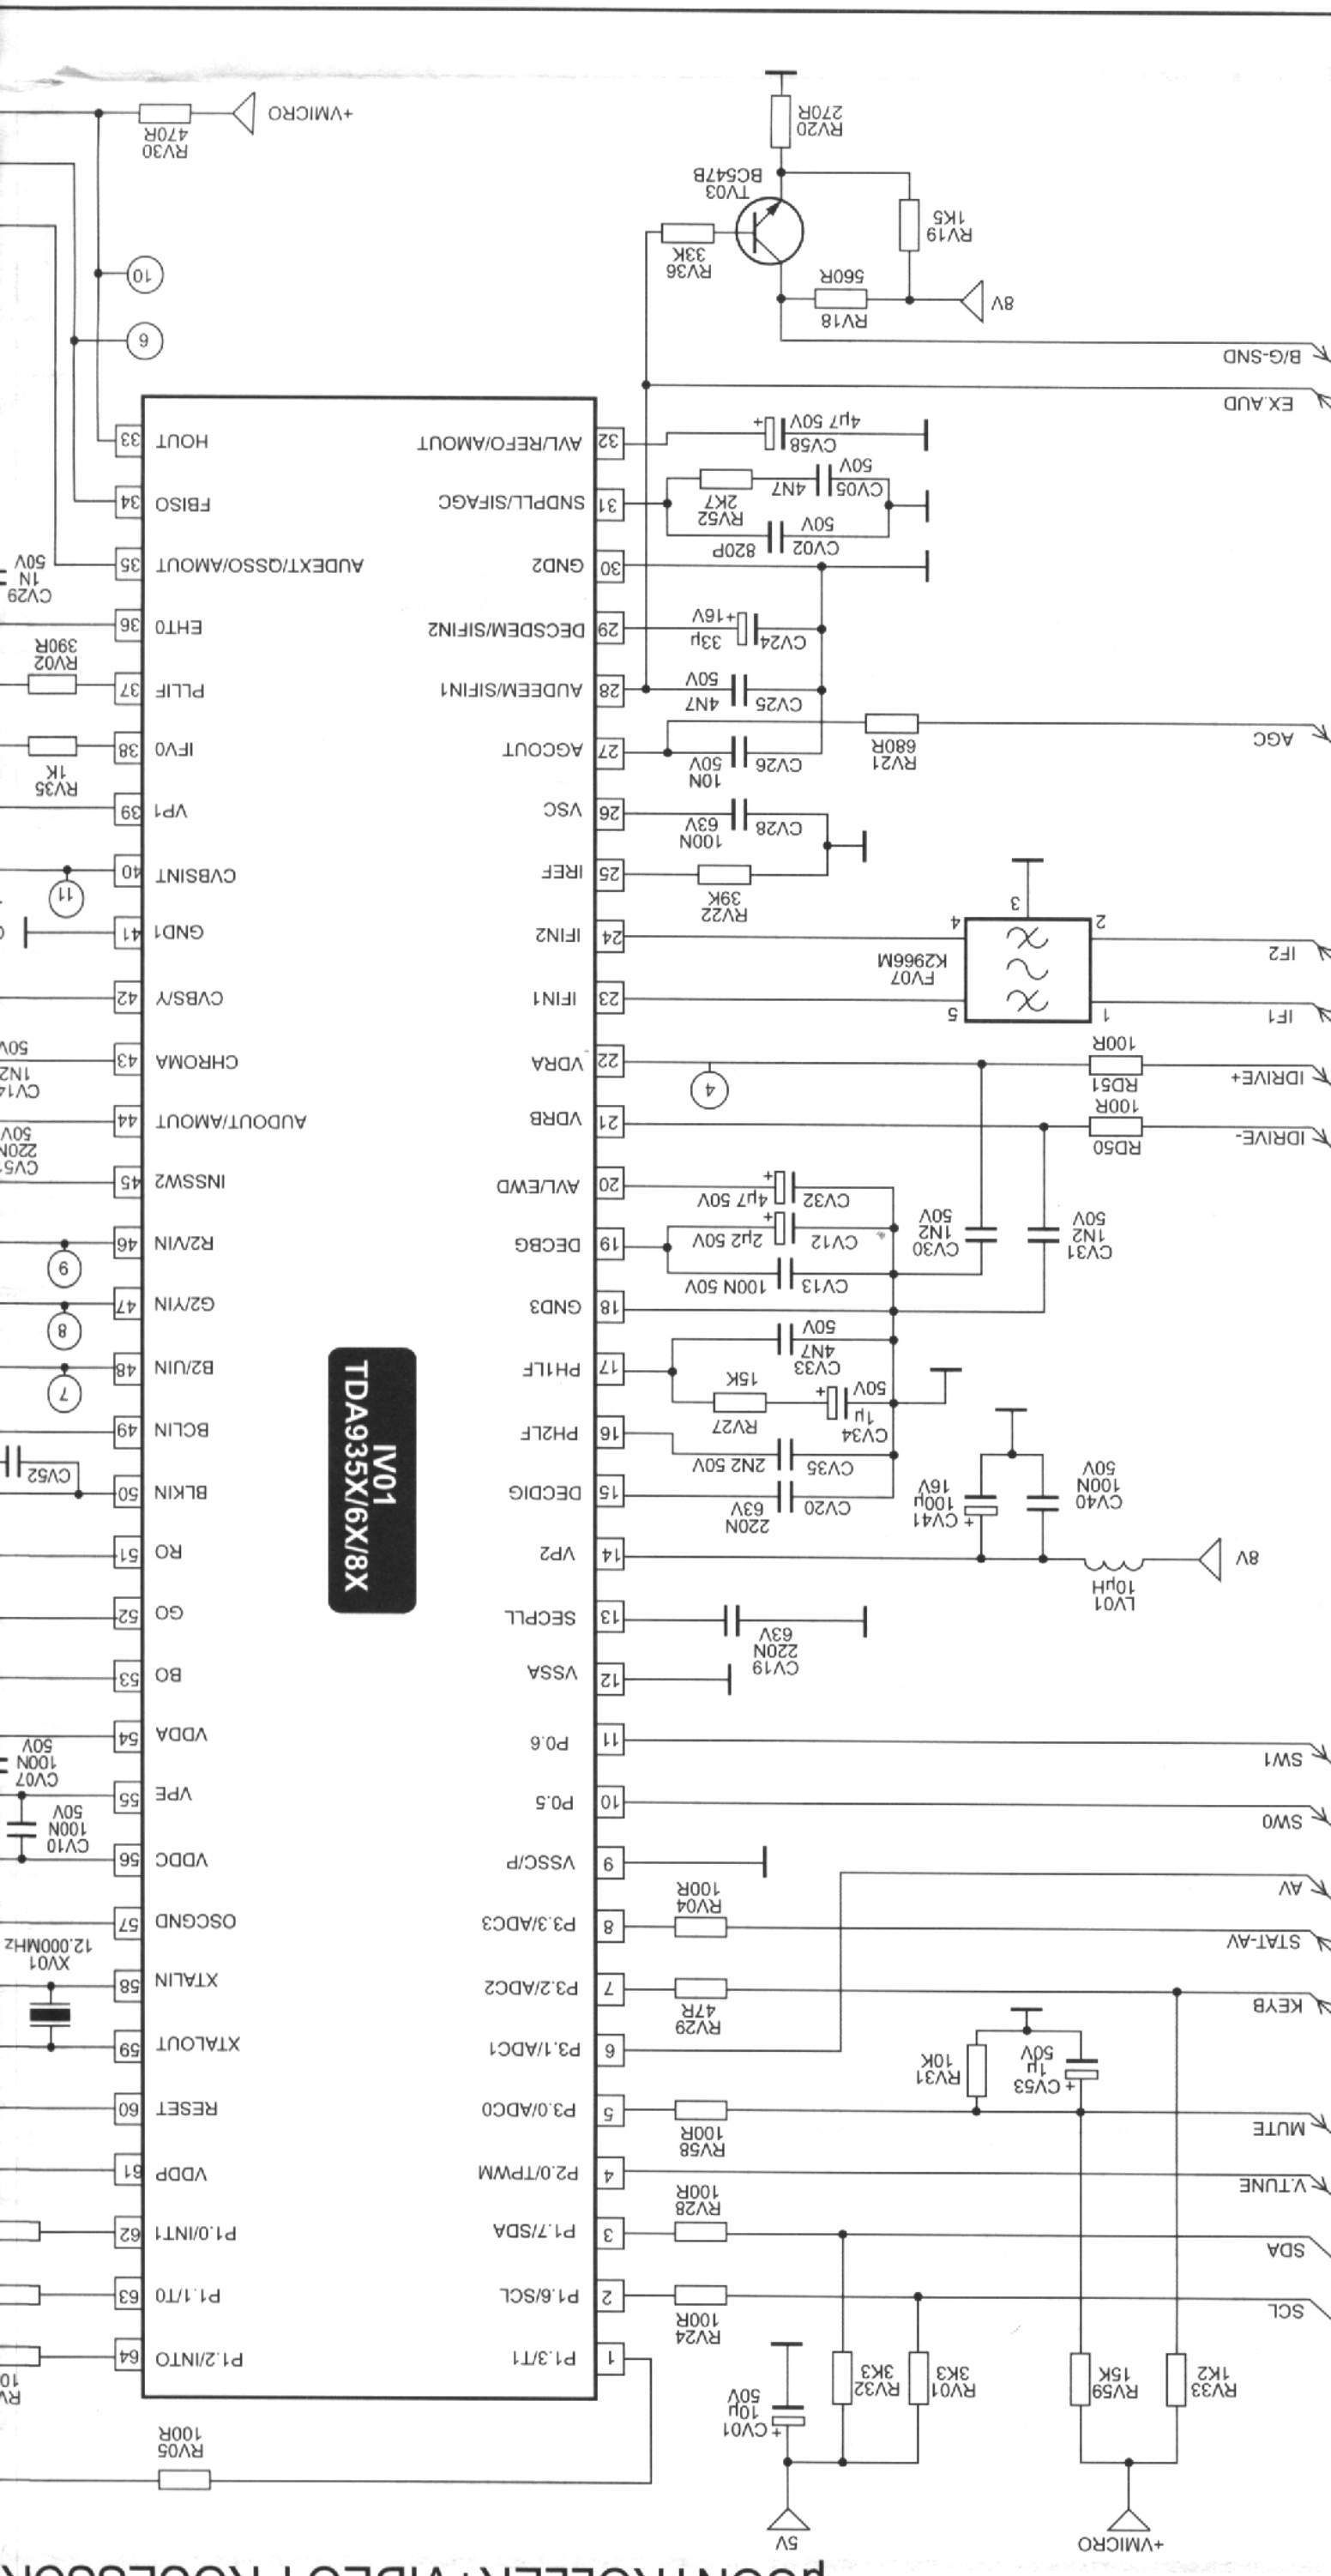





SECCAM L/L MONO

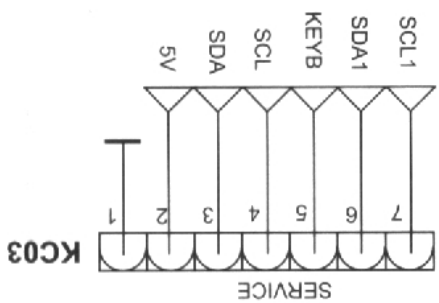


## SERVICE

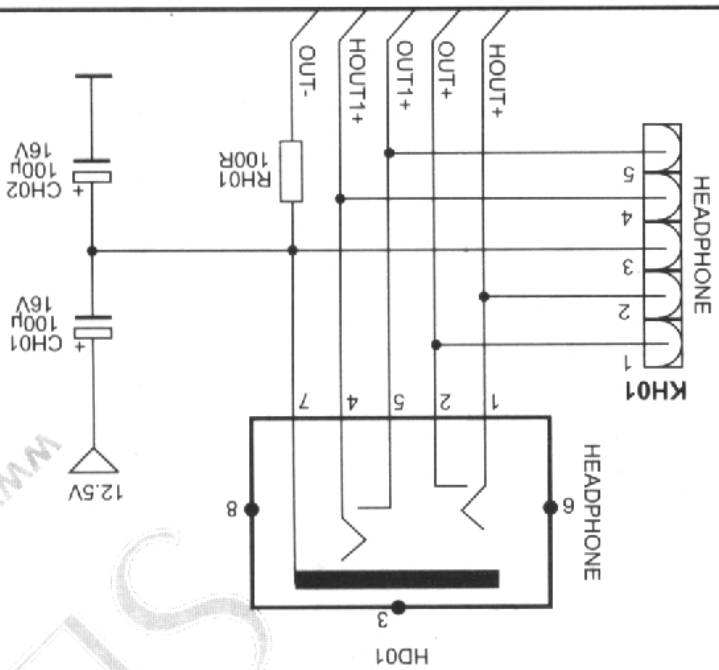

## HEADPHONE

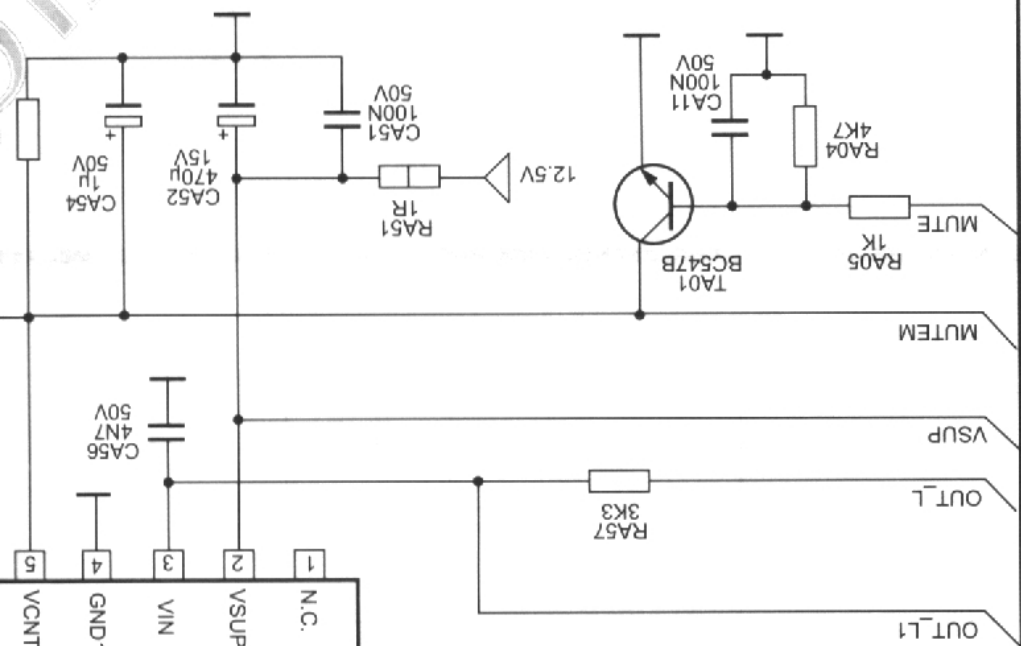

## MONO AUDIO AMPLIFIER

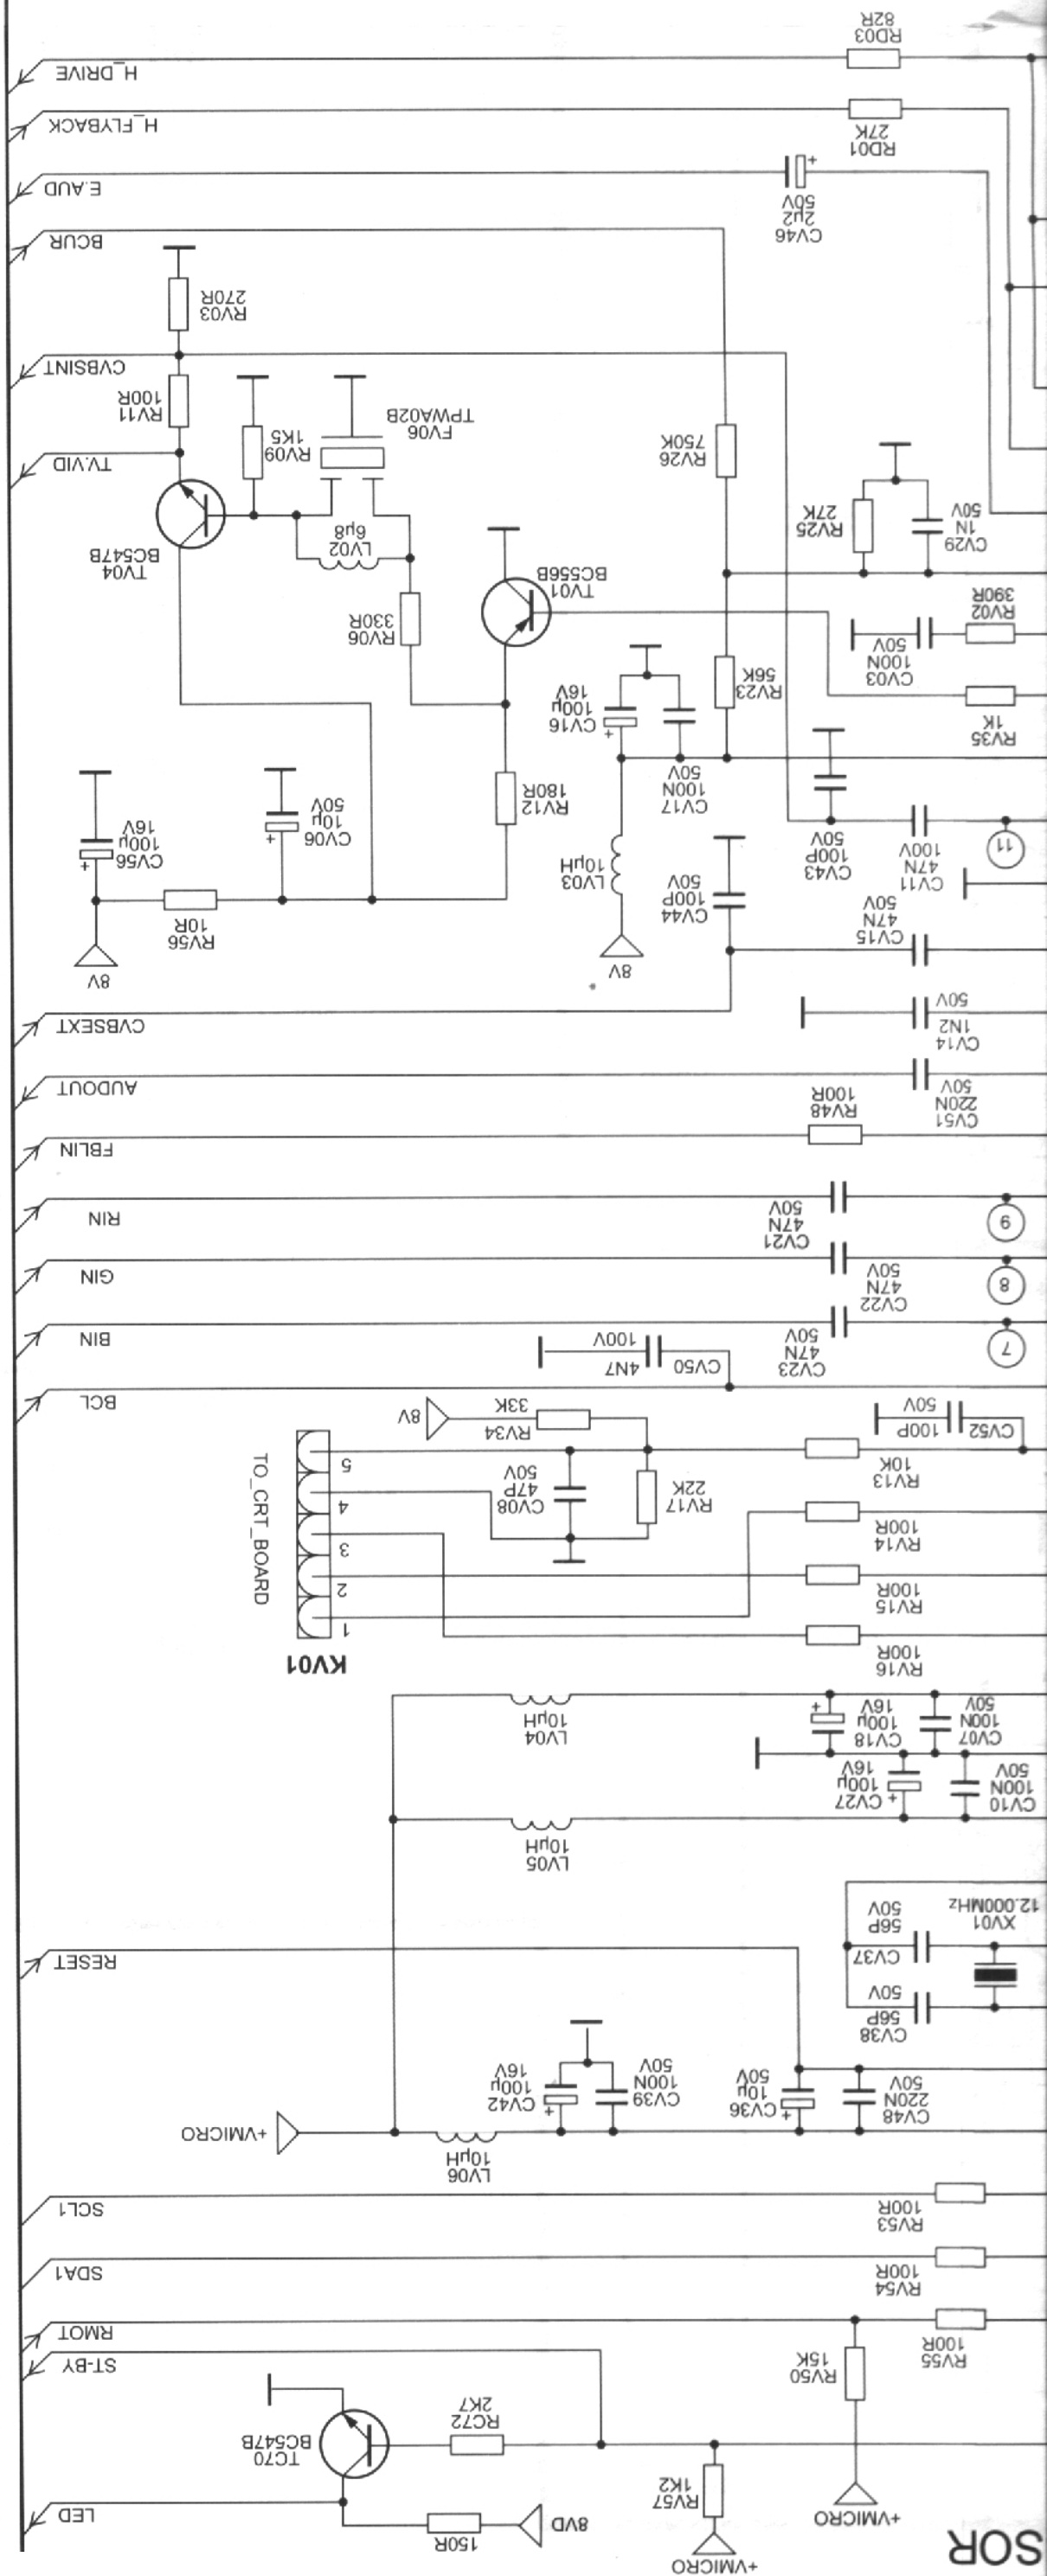

## INFRARED MODULE

